



PC-Programmable Frequency
Transmitter and Display

FDY

User's Manual

All product names are registered trademarks of their respective companies.

*Demand MOORE Reliability*

Customer Support

Moore Industries is recognized as the industry leader in delivering top quality to its customers in products and services. We perform a sequence of stringent quality assurance checks on every unit we ship. If any Moore Industries product fails to perform up to rated specifications, call us for help. Our highly skilled staff of trained technicians and engineers pride themselves on their ability to provide timely, accurate, and practical answers to your process instrumentation questions. Our headquarters and other facilities phone numbers are listed below.

There are several pieces of information that can be gathered before you call the factory that will help our staff get the answers you need in the shortest time possible. For fastest service, gather the complete model and serial number(s) of the problem unit(s) and the job number of the original sale.

Locations

World Headquarters

16650 Schoenborn Street
North Hills, California
91343-6196, U.S.A.
Tel: (818) 894-7111
Fax: (818) 891-2816
E-mail: info@miinet.com
TOLL FREE: 1-800-999-2900
www.miinet.com

China

Room 806, Block 2,
Lotus International Plaza
No. 7866 Hu Min Road,
Min Hang District,
Shanghai, 201102, P. R. China
Tel: 86-21 62491499
Fax: 86-21 62490635
E-mail: sales@mooreind.sh.cn
www.miinet.com/cn

Europe

1 Lloyds Court, Manor Royal,
Crawley
W. Sussex RH10-9QU
United Kingdom
Tel: 01293 514488
Fax: 01293 536852
FREE PHONE: 0800 525107
sales@mooreind.com
www.miinet.com/uk

Drie Eikenstraat 362
B-2650 Edegem
Belgium
Tel: 03/448.10.18
Fax: 03/440.17.97
info@mooreind.be
Dutch: www.miinet.com/dbe
French: www.miinet.com/fbe

Burg Meslaan 98
4003 CD Tiel
The Netherlands
Tel: (0)344-617971
Fax: (0)344-615920
sales@mooreind.nl
www.miinet.com/nl

Australia

Sydney, NSW
3/1 Resolution Drive
Caringbah, New South Wales
2229
Australia
Tel: (02) 8536-7200
Fax: (02) 9525-7296
sales@mooreind.com.au
www.miinet.com/au

Perth, WA
6/46 Angove Street
North Perth, Western Australia
6006
Australia
Tel: (08) 9228-4435
Fax: (08) 9228-4436
sales@mooreind.com.au
www.miinet.com/au

www.miinet.com

Table of Contents

Introduction.....	4
About this Manual	4
Specifications	5
PC Configuration Software.....	8
Programming the FDY.....	10
Connecting the FDY to the PC.....	10
Programming the Basic Parameters	11
Programming the Input Parameters	11
Programming the Range Parameters	12
Programming the Output Parameters	13
Programming the Trimming Parameters	14
Sensor Trimming.....	14
Output Trimming.....	14
Loop Test.....	15
Programming the Custom Curve Parameters	15
Editing the Custom Curve Table.....	16
Downloading the Configuration File	16
Installing the FDY	17
Installation in Hazardous Locations	18
Specific Conditions of Use.....	19
Installation in non-Hazardous Locations	19
Specific Conditions of Use.....	19
Customer Service	20
Certification Information.....	21
Warranty Information	22

Introduction

The FDY

This is the user's manual for the Moore Industries' FDY PC-Programmable Frequency Transmitter and Display. Incredibly versatile, the FDY programs in less than a minute to accept varying frequency signals from AC or DC flow measurement devices such as turbine meters and magnetic pick-up coils.


The FDY monitors the signal, outputting the selected variable (frequency, period, high pulse width, low pulse width or contact closure) both to its display and to a 4-20mA signal that is linear and input-scaleable. The FDY features a large integral display that shows real-time process status.

About this Manual

Wherever you see a "**Note**", "**Caution**" or "**WARNING**" pay particular attention.

- A "**Note**" provides information to help you in avoiding minor inconveniences during calibration, installation or operation of the FDY.
- A "**Caution**" provides information on steps to take in avoiding procedures and practices that could risk damage to the FDY or other equipment.
- A "**WARNING**" provides information on steps to take in avoiding procedures and practices that could pose safety risks to personnel.

Figure 1. The FDY Accepts a Frequency Signal and Outputs a Scaleable 4-20mA Signal

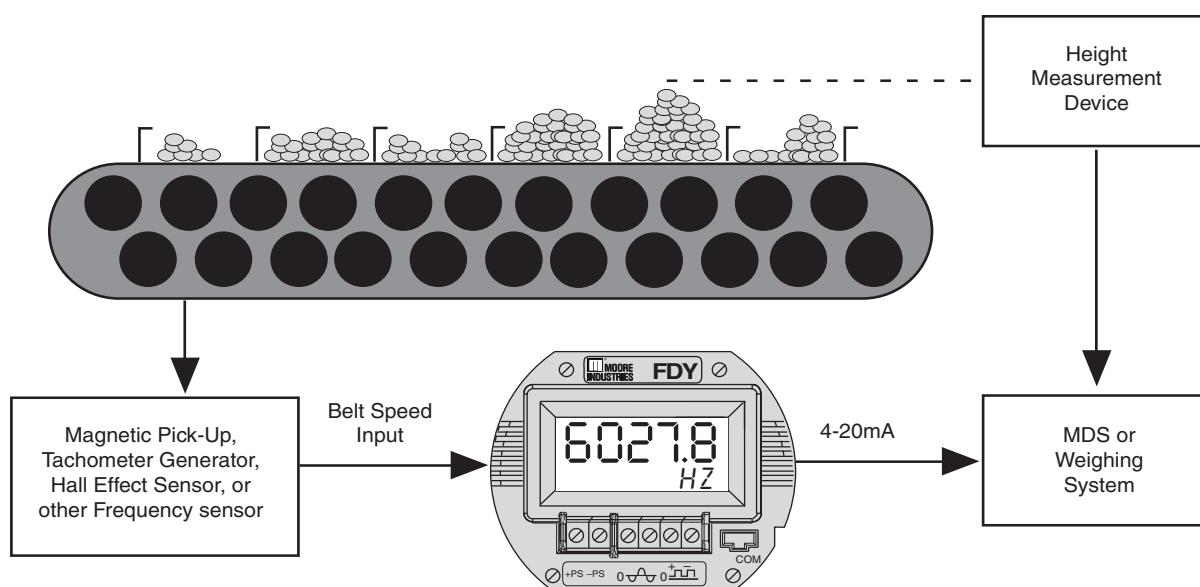

Specifications

<p>Performance</p> <p>Input Accuracy: See Tables 2-7</p> <p>Output Accuracy: $\pm 0.015\%$ of span</p> <p>Overall Accuracy: The overall accuracy of the unit is the combined input and output accuracies. It includes the combined effects of linearity, hysteresis, repeatability and adjustment resolution. Does not include ambient temperature effect.</p> <p>Input Hysteresis: See Tables 5-7</p> <p>Input Threshold: See Tables 5-7</p> <p>Stability: See Table 1</p> <p>Minimum Frequency: Twice the lower range</p> <p>Digital Input Filter: 3dB point is at 10kHz</p> <p>Step Response Time: 300msec maximum, 200msec typical from the time an input is applied to the output reaching 90% of its final value + actual input</p> <p>Rise Time: 100msec maximum for the output to change from 10% to 90% of its scale of an input step change of 0% to 100% + actual input</p> <p>Isolation: 500Vrms between input, output, and case continuous, and will withstand a 500 Vac dielectric strength test for one minute with no breakdown</p> <p>Ripple: 10mV peak-to-peak measured across a 250 ohm resistor</p> <p>Overcurrent Limiting: 25mA maximum</p> <p>Maximum Voltages: 48Vdc output, maximum; DC input, 48Vdc, maximum; AC input, 30Vac maximum for 0.02-30AC model, 250Vac maximum for 10-250AC model</p>	<p>Performance (Continued)</p> <p>Input Impedance: >30kohms for DC and contact closure inputs; 2kohms for input >6V, 4kohms typical@50Hz and 56kohms typical@1kHz for input <6V for 0.02-30AC model; >125kohms for 10-250AC model</p> <p>Load Capability: (508 ohms@24V)</p> <p>Supply Voltage - 12V $0.0236A = \text{Ohms}$</p> <p>Output Current Limiting: 3.8mA and 21.4mA for input under range and over range; 3.6mA and 23.6mA for input failure</p> <p>Load Effect (current outputs): Negligible within specified power limits</p> <p>Power Supply Effect: $\pm 0.002\%$ of span per 1V change</p> <p>Startup Time: Performance within specification less than 1sec after power is applied for frequency higher than 100Hz and average of 8 samples</p> <p>Damping: Adjustable from 0 to 30 seconds with PC software</p> <p>Linearization: Configurable up to 128 points with PC software</p> <p>Moving Average: Configurable up to 16 segments with PC software</p> <p>Low Pass Filter: On/Off is software configurable</p>	<p>Display</p> <p>Type: LCD; Top Row, 10.16mm (0.4 in) high black digits on a reflective background; Bottom Row, 5.72mm (0.225 in) high black digits on a reflective background</p> <p>Display Update Rate: 100msec</p> <p>Format: Top row is five alphanumeric characters, plus sign and decimal point; bottom is five alphanumeric characters</p> <p>Range: -99999 to 99999</p> <p>Minimum Display Span: 1.00</p> <p>Ambient Conditions</p> <p>Operating & Storage Range: -40 to +85°C (-40°F to +185°F);</p> <p>I.S. Operating Range: -40° to +65°C (-40°F to +149°F);</p> <p>Relative Humidity: 0-95%, non-condensing</p> <p>Ambient Temperature Effect: Input to output, $\pm 0.007\%$ of span/°C maximum; Digital Accuracy, $\pm 0.003\%$ of span/°C maximum</p> <p>RFI/EMI Immunity: 30V/m when tested according to SAMA 33.1 abc with 0.5% of span or less error. 20V/m@ 80-1000MHz, 1kHz AM, when tested according to IEC1000-4-3-1995</p> <p>Noise Rejection: Common mode, 120dB typical@100mVp-p input</p> <p>Weight</p> <p>FDY HP: 227g (5.3 oz)</p> <p>FDY in BH housing with glass cover: 1.45kg (3 lbs, 12.4 oz)</p> <p>FDY in D-BOX housing: 811g (1 lb, 6.3 oz)</p>
--	--	---

Table 1. Stability for All Models*

		Input-to-Display (% of Reading)			Display-to-Output (% of Output Span**)		
		1 year	3 years	5 years	1 year	3 years	5 years
Frequency/Period		0.001	0.0017	0.0022	0.08	0.139	0.179
Pulse Width	1 Sec	0.001	0.0017	0.0022			
	0.1 Sec	0.0015	0.0026	0.0034			

*Combine Input-to-Display and Display-to-Output values to determine overall stability.

**Consult factory for improved long-term drift specifications.

NOTE:

AC indicates zero-crossing signal.

DC indicates non-zero crossing signal.

Table 2. DC Input Accuracy and Minimum Amplitude

Input Type	Input	Accuracy	Minimum Amplitude
Frequency	< 5kHz	0.01% \pm 1 LSD	100 mV
	5kHz - 20kHz	0.05% \pm 1 LSD	200 mV
	> 20kHz	0.10% \pm 1 LSD	200 mV
Period	< 50 μ s	0.10% \pm 1 LSD	200 mV
	50 μ s - 200 μ s	0.05% \pm 1 LSD	200 mV
	> 200 μ s	0.01% \pm 1 LSD	100 mV
Pulse Width	entire range	0.05% \pm 1 LSD \pm 2 μ s	1 V
Contact Closure	entire range	0.01% \pm 1 LSD	

Table 3. AC Input Accuracy and Minimum Amplitude

Input Type	Input	Accuracy	Minimum Amplitude
Frequency	< 10Hz	0.01% \pm 1 LSD	20 mV
	10Hz - 5kHz	0.01% \pm 1 LSD	200 mV
	5kHz - 20kHz	0.05% \pm 1 LSD	200 mV
	> 20kHz	0.10% \pm 1 LSD	1 V
Period	< 50 μ s	0.10% \pm 1 LSD	1 V
	50 μ s - 200 μ s	0.05% \pm 1 LSD	200 mV
	200 μ s - 100ms	0.01% \pm 1 LSD	200 mV
	> 100ms	0.01% \pm 1 LSD	20 mV

Table 4. AC Input Accuracy and Minimum Amplitude For 10-250V Input Type

Input Type	Input	Accuracy	Minimum Amplitude
Frequency	< 5kHz	0.01% \pm 1 LSD	10V
	5kHz - 20kHz	0.05% \pm 1 LSD	10V
	> 20kHz	0.10% \pm 1 LSD	10V
Period	< 50 μ s	0.10% \pm 1 LSD	10V
	50 μ s - 200 μ s	0.05% \pm 1 LSD	10V
	> 200 μ s	0.01% \pm 1 LSD	10V

Table 5. Maximum Configurable Input Range And Minimum Span

Input Type	Max Configurable Range	Min Span
Frequency	0 - 25kHz	See Table 9
Period	0 - 70s	500 μ sec
Pulse Width	0 - 70s	500 μ sec
Contact Closure	0 - 20Hz	0.1Hz

Table 6. Frequency Input Parameters

Input Range	Threshold		Hysteresis		Filter (3db Point)	Measured Frequency
	Resolution	Range	Resolution	Range		
100mV-30V (DC)	1mV	0.01-2.5V	1mV	0.01-1.5V	10kHz	0.02Hz to 25kHz
20mV-30V (AC)			1mV	0.002-0.15V	10kHz	0.5Hz to 25kHz
10V-250V(AC)			1mV	0.002-0.15V	10kHz	0.5Hz to 25kHz

Table 7. Period Input Parameters

Input Range	Threshold		Hysteresis		Filter (3db Point)	Measured Period
	Resolution	Range	Resolution	Range		
100mV-30V (DC)	1mV	0.01-2.5V	1mV	0.01-1.5V	10kHz	40 μ sec to 50sec
20mV-30V (AC)			1mV	0.002-0.15V	10kHz	40 μ sec to 2sec
10V-250V (AC)			1mV	0.002-0.15V	10kHz	40 μ sec to 2sec

Table 8. Pulse Width Input Parameters

Input Range	Threshold		Hysteresis		Filter (3db Point)	Measured Pulse Width
	Resolution	Range	Resolution	Range		
100mV-30V (DC)	1mV	0.01-2.5V	1mV	0.01-1.5V	10kHz	0.2msec to 50sec

Table 9. Frequency Range Minimum Span

Maximum Frequency Range	Minimum Span
10Hz	0.1Hz
5kHz	1Hz
25kHz	25Hz

Figure 2. FDY Dimensions

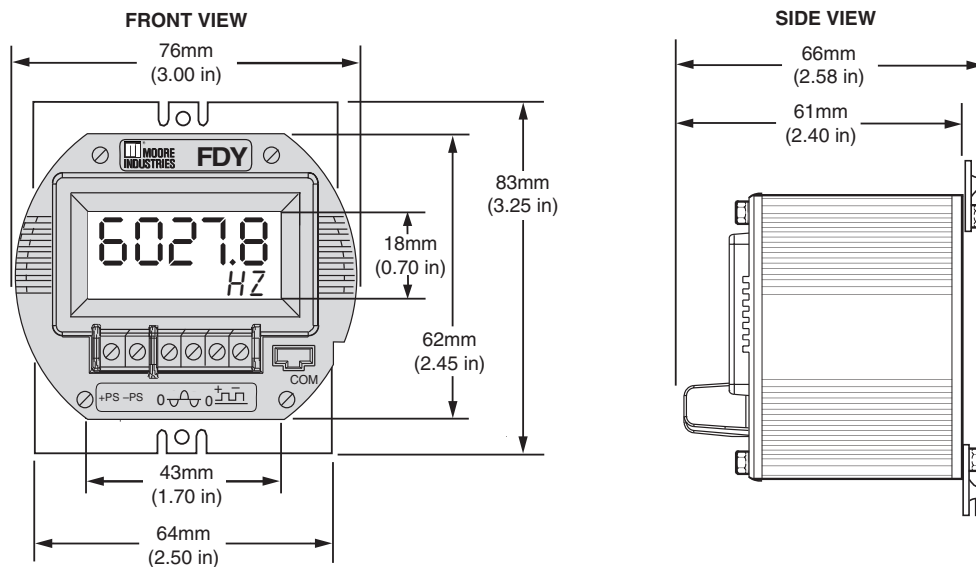


Figure 3. BH Enclosure Dimensions


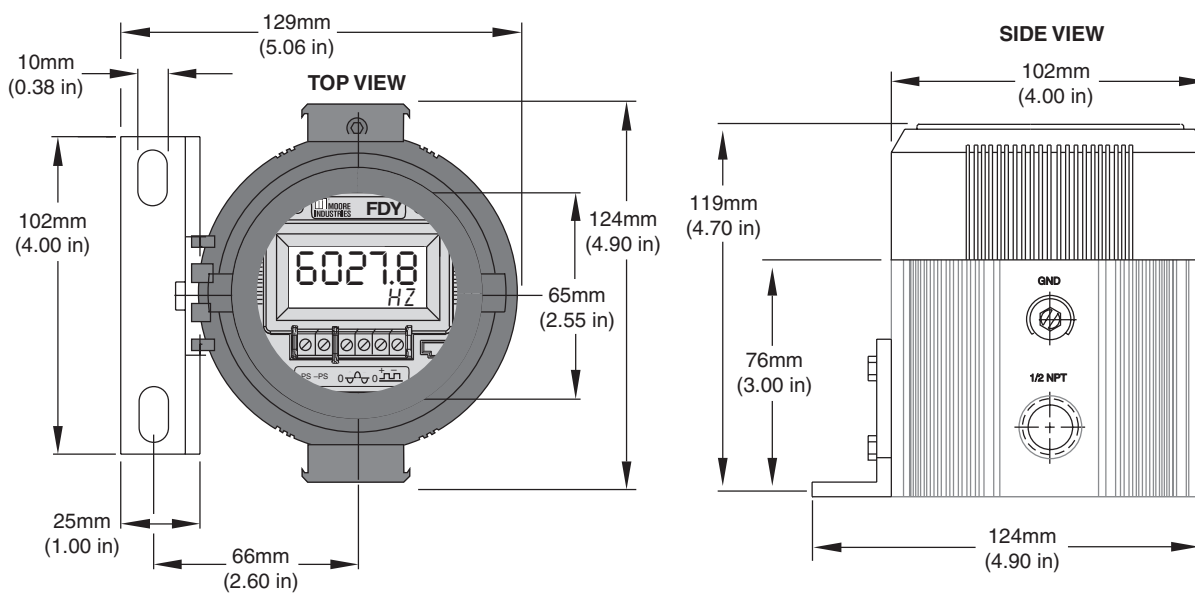


Figure 4. D-BOX Enclosure Dimensions

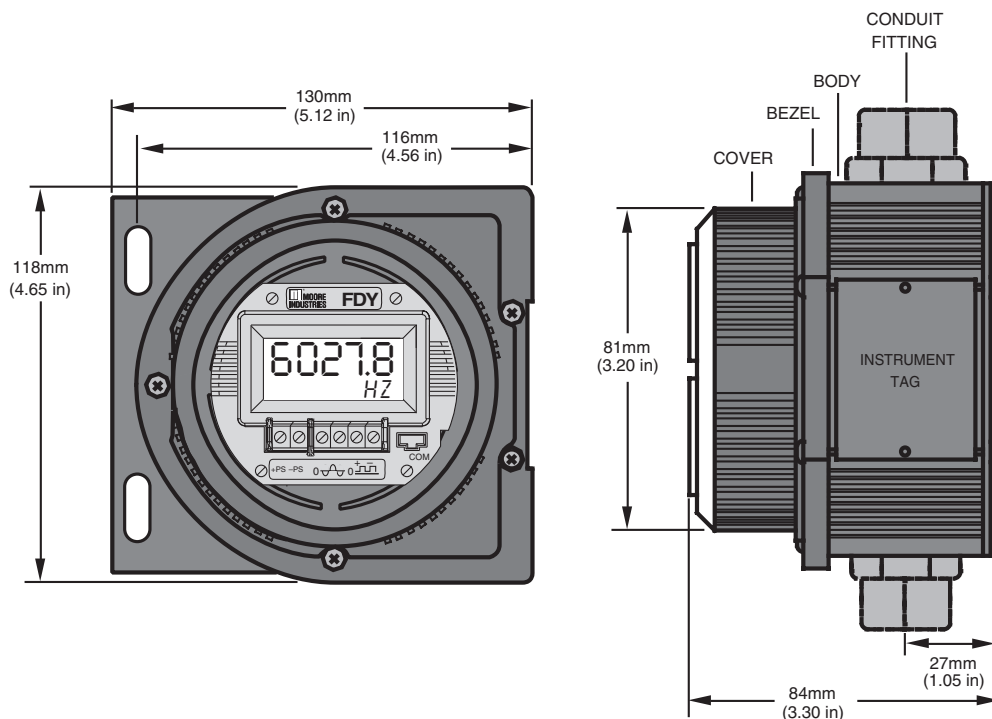

PC Configuration Software

The FDY PC Configuration Software is used to program all of the FDY's parameters. For detailed information on how to use our configuration software, access our HelpMap Navigation System. The PC Software is made up of these sections:

1. **Program Status & Device ID**—The *Program Status* portion of the screen displays the activity of the connected unit. It will show you if the unit is *Idle*, *Uploading*, *Downloading* or *Monitoring*. *Device ID* displays the type of device that is being polled and its ID number.
2. **Tag/Descriptor/Message**—These boxes are used to program a FDY with an individual tag, descriptor or message used for easily identifying the unit. The *Programmed Date* stores the last time that the unit's configuration was updated.
3. **Device Configuration**—Displays the current configuration of the attached FDY.

4. **Measurement Mode**—The drop-down menu selects which type of measurement the FDY will monitor.

5. **Variables/Device Status/Communications**—These sections display the status of the FDY and its process. The *Variables* section displays the input to the FDY, FDY output and the percent of span. The *Device Status* provides advanced diagnostic information on the FDY. The *Communications* box displays the status of the FDY's communication with the PC Program.

6. **Input/Range/Output/Trimming/Custom Curve Tabs**—These tabs change the right side of the screen to allow you to set the appropriate part of the FDY's configuration. See corresponding sections of this manual for additional information on these tabs.


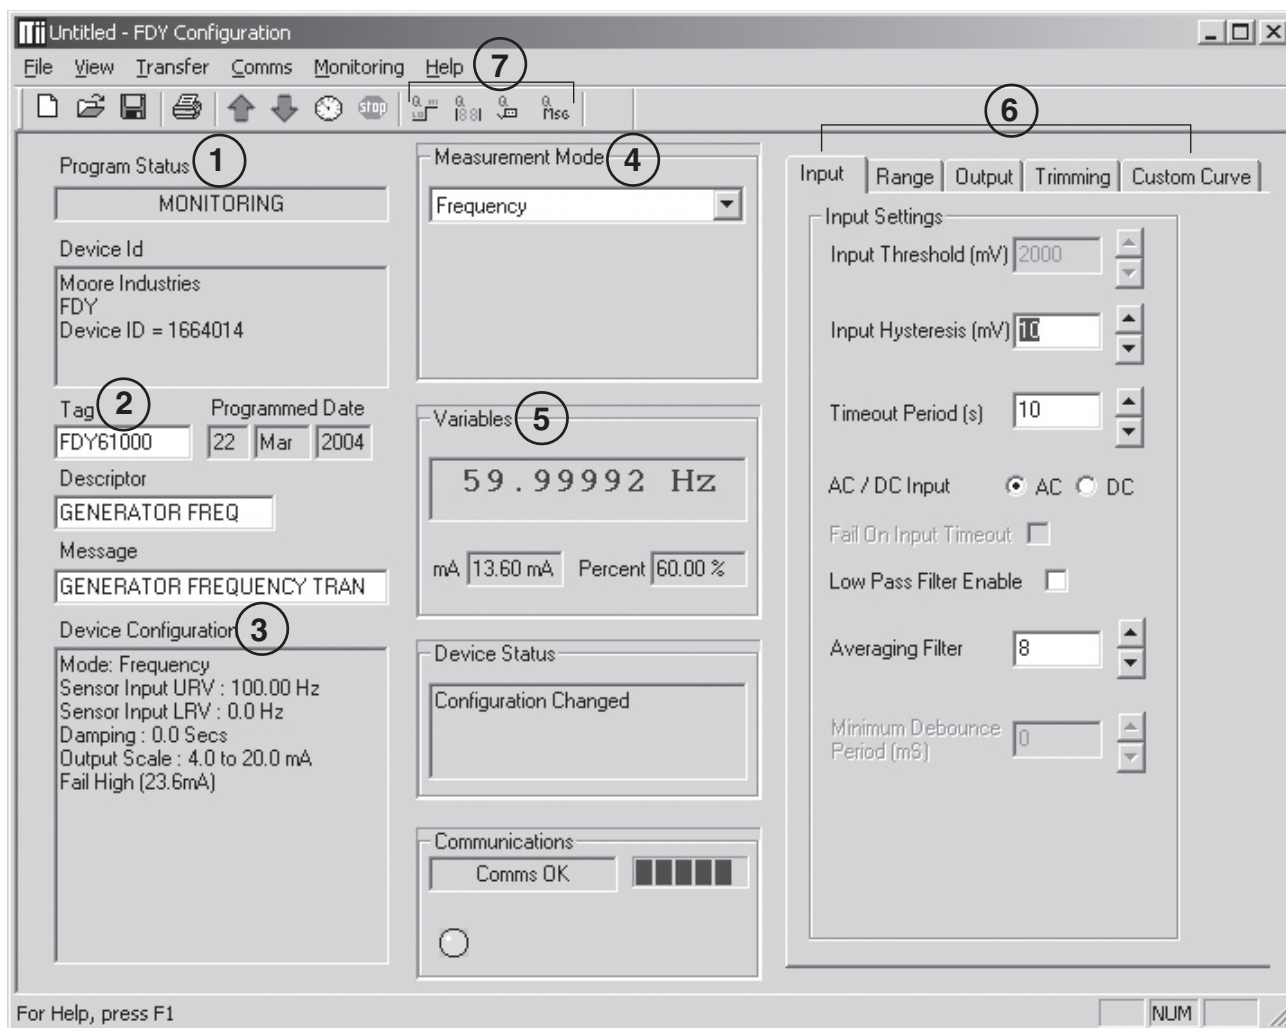
7. **Quickset Buttons**  —These buttons allow you to program just one part of the FDY's configuration program. From left to right, they program: *Fail Mode*, *Display Mode*, *Tag* and *Message*.

Figure 5. All of the FDY Operating Parameters can be set from the Main Screen of the Configuration Program.



Default/Factory Configurations

The following are the default factory settings for your unit:

Input:

Measurement Mode: Frequency 0-100Hz
Input Hysteresis: 10mV
Timeout Period: 10s
AC/DC Input: AC
Low Pass Filter: Disabled
Averaging Filter: 8
Minimum Debounce Period: 10mS
Scaling Disabled

Output:

4-20mA
Damping: 0s
Fail Mode: High (23.6mA)
Display Mode: Primary Variable

Programming the FDY

All operating parameters of the FDY are set using a PC, a serial communication cable and Moore Industries' Intelligent PC Configuration software. When the PC Configuration program is loaded and running, most of the parameters for the connected transmitter are shown on a single screen. This makes it easy to determine which aspects of transmitter operation need to be changed to suit the application requirements.

Once the software settings are made, they are downloaded to the transmitter in the form of a configuration file and stored in the non-volatile unit memory. You can choose to save a backup copy of the file on your PC hard drive or external media.

Program the FDY by connecting the FDY to the PC, setting the appropriate parameters in the PC program, and downloading the configuration.


Connecting the FDY to the PC

The first step in configuring the FDY is connecting the transmitter to the PC program and attaching the appropriate input devices. Connect the FDY as shown in Figure 6 below; refer to Table 9 for a description of required equipment. After the FDY is configured, you can begin programming the basic parameters.

Table 9. Assembling the Necessary Equipment

Device	Device
Frequency Input Simulator	Variable, accurate to $\pm 0.005\%$ of reading
Power Supply	12-42Vdc
Precision Load Resistor	250 ohms, $\pm 0.01\%$
Multimeter	Accurate to $\pm 0.025\%$ of reading
Personal Computer	Microsoft Windows based PC; 16Mb free RAM; 20MB free disk space on hard drive Microsoft Windows 7, 10 1 (one) serial port or one available USB port (with optional USB cable)
Communications Cable	Isolated cable P/N: 803-039-26 Non-isolated cable P/N: 803-040-26 or optional USB cable P/N: 208-836-00
Communications Software	Version 1.0 or greater, part number: 750-75E05-01

Figure 6. Connecting the FDY to the PC

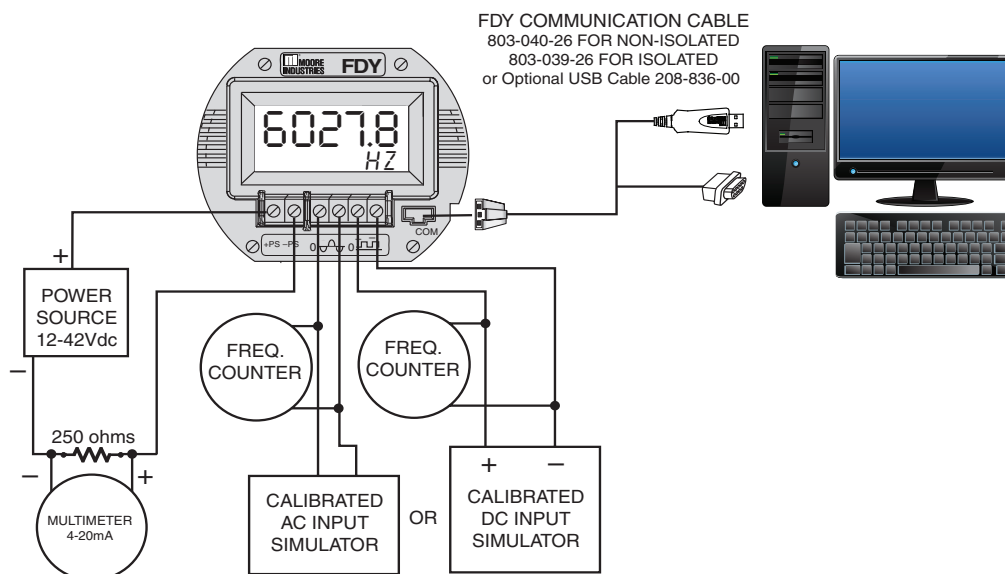

Programming the Basic Parameters

Programming the Basic Parameters involves selecting the desired parameters in the PC Program, then downloading those parameters to the FDY. Begin by entering the device identification and measurement mode parameters into the configuration software.

Device Identification Information

The **Tag** (8 characters, maximum), **Descriptor** (16 characters, maximum) and **Message** (32 characters, maximum) boxes allow you to assign a unique identity to each FDY.

Measurement Mode

Select from Frequency, Period, Pulse Width High, Pulse Width Low and Contact Closure. This selects the variable to be measured and displayed. (Unless a custom EGU is selected in the Custom Curve tab.) (See Figure 5, section 4).

Programming the Input Parameters

When setting input parameters, please read the following information for guidance. All input voltages above 3V are internally clamped at 3V and all AC signals are squared and measured at the zero crossing. Therefore the settings for input threshold and hysteresis assume a maximum input of 3V.

Use the Input tab in Figure 7 to enter the following parameters:

Figure 7. Input Parameters Tab

AC / DC Input: Select the type of input the FDY will measure.

Input Threshold: Input threshold is applicable to DC inputs only. Input Threshold is the input voltage above which the input is considered high. For input voltages above 3V, it is recommended to set this to the default setting of 2V (maximum is 2.5V). For input voltages below 3V, it is recommended to set this to 2/3 of the peak-to peak (p-p) input signal voltage plus the low state signal voltage.

Input Hysteresis: This is the difference between high and low voltage points at which the input circuit detects changes of input state. For DC inputs this must be less than the threshold. For example, if the threshold is set for 2V, and the hysteresis is set for 1.2V, the FDY will detect high for >2V and low for <0.8V.

- For DC input voltages above 3V, it is recommended to set this to the default setting of 1.2V (maximum is 1.5V).
- For DC input voltages below 3V, it is recommended to set this to 1/3 of the peak-to peak (p-p) input signal voltage plus the low state signal voltage.
- For AC inputs the hysteresis is used to minimise noise interference. Above 3V, it is recommended to set this to 150mV.
- For AC inputs below 3V, it is recommended to set this to 10% of the signal voltage level.

Timeout Period: The number of seconds that the input will remain at lower range value before the FDY declares a hardware error, if the **Fail On Input Timeout** box is checked. The Timeout Period can be configured at minimum of 0.5sec to a maximum of 600sec, factory default is set to 10sec.

NOTE:

The timeout period must be set greater than the Lower Range Value period if Fail On Input Time-out is enabled.

Fail On Input Timeout: If your input is lower than the allowed **Lower Range Value** and the **Fail On Input Timeout** feature is enabled, **Broken Wire** (in the **Device Status** section of the PC Program) or **Broke Input** (on the FDY display) is declared after the set Timeout Period has passed.

NOTE:

If the Lower Range Value is set to 0Hz in the Input Range the Fail On Input Time-out feature will not be available, the Lower Range Value must be set to a value greater than zero to enable this feature (box must be checked to apply feature) .

Low Pass Filter Enable: Reduces noise by filtering out high frequency signals.

NOTE:

Moore Industries recommends having the Low-Pass filter turned on when the upper input range value is less than 150Hz (especially on the 10VAC - 250VAC units).

Averaging Filter: Shows the number of readings the FDY averages together to provide the displayed reading. This can be used to compensate for bent blades in a monitored turbine by setting the value to equal the number of blades on the turbine. (i.e. if the turbine has four blades, set the Averaging Filter to 4).

Minimum Debounce Period: Available only when contact closure is selected in measurement mode. This value eliminates noise from a contact closure input, but lowers the maximum measurable frequency.

After selecting the input parameters, continue by clicking the **Range** tab and proceeding to the **Programming the Range Parameters** section.

Programming the Range Parameters

The **Range** tab permits you to set or capture the acceptable input range and establish range limits.

- Use the **Lower Range Value** cell to set the input value that will correspond to a 4mA output. In the same way, use the **Upper Range Value** to set the input value that corresponds to a 20mA output.
- Reverse the output (causing the output to increase as the input decreases) by setting the **Lower Range Value** higher than the **Upper Range Value**.
- The **Capture Lower Range** and **Capture Upper Range** buttons permit you to trim the upper and lower range of the sensor (if necessary). Just click the appropriate button to begin trimming.

You are given the option of scaling your process variable reading. To do this, click the **Enabled** check box in the **Scaling** section. Scaling allows you to take your process variable and manipulate the reading to a more customized range.

- In the **Upper Scaling Value** text box, enter the value you wish displayed when your input is at its full range. Repeat the step for the value you wish displayed when your input is at its zero value and enter that into the **Lower Scaling Value** box.

At the **Scaled Mode Display Label** box, enter the specific EGU (Engineering Unit) that you want as your display.

- The **Range Limits** section allows you to designate when the input will be considered bad (over or under range). For example, if you have set the **Lower Range Value** for 20, you can set the **Under Range** for 10 and check the **Enable** box, allowing the input to decrease below 10Hz before an error is registered. In this case, the display shows **Under/Over range**, and the output is in **Failure Mode** (see **Programming Output Parameters**).

Figure 8. Range Parameters Tab

The screenshot shows the 'Range' tab of the software interface. It is divided into three main sections: 'Range', 'Scaling', and 'Range Limits'.
 - The **Range** section includes 'Sensor Limits = 0.0 to 25000.0 Hz', 'Upper Range Value' (100), and 'Lower Range Value' (0). Below these are 'Capture Lower Range' and 'Capture Upper Range' buttons.
 - The **Scaling** section features an 'Enabled' checkbox, a 'Quick Set' button, 'Upper Scaling Value' (100), 'Lower Scaling Value' (0), and a 'Scaled Mode Display Label' text box.
 - The **Range Limits** section contains 'Over Range' (100) and 'Under Range' (0), each with an 'Enable' checkbox.

Programming the Output Parameters

The *Output* section of the PC software is composed of three sections: *Output Settings*, *Failure Mode* and *Display Mode*. Use the functions of *Output Settings* to set the current range from 3.8 to 21.6mA (usually 4-20mA). The minimum span is 4mA.

Figure 9. *Output Parameters Tab*

The screenshot shows the 'Output Parameters Tab' with the following settings:

- Output Settings:**
 - Lower Range Output Current (mA): 4
 - Upper Range Output Current (mA): 20
 - PV Damping (0-30 secs): 0
- Failure Mode:**
 - ☐ Fail Low (3.6mA)
 - ☒ Fail High (23.6mA)
- Display Mode:**
 - ☒ Primary variable
 - ☐ Current
 - ☐ Percentage
 - ☐ Display Toggle (PV / Current)

Output Settings

The output can be reversed (causing the output to increase as the input decreases) by setting the *Lower Range Value* in the *Range* tab as higher than the *Upper Range Value* (See Figure 8).

PV (Primary Variable) *Damping* precisely reads the input then specifies an exponential change in the output by 60% over the time set in the *PV Damping* box. This reduces the effect of sudden spikes and helps stop unnecessary alarms by smoothing the reading.

Failure Mode

Failure Mode lets you set the output of the transmitter when it is malfunctioning. It will either transmit a 3.6mA (set to *Fail Low*) or a 23.6mA (set to *Fail High*) signal.

NOTE:

The Failure Mode has no effect unless one of the fail conditions is active (i.e. Fail On Input Time-out or Over/Under Range Limits).

Display Mode

Display Mode selects which variable will be displayed on the transmitter's display. Choose between *Primary Variable*, *Current*, *Percentage* and *Display Toggle*. (Display Toggle switches back and forth from the primary variable to current and back in one-second increments). The PC Program's display is not changed by changing the selection under the *Display Mode*.

After the *Range* parameters have been selected, you can continue on by clicking on the *Trimming* tab, and proceeding to *Programming the Trimming Parameters*.

Figure 3. *BH Enclosure Dimensions*

Programming the Trimming Parameters

The *Trimming* tab includes *Sensor (Input) Trimming*, *Output Trimming* and *Loop Test* functions.

Figure 10. Trimming Parameters Tab

Sensor Trimming

Sensor Trimming increases the measured accuracy of your transmitter by matching the reading of its actual input to either a calibrated source or the master device to which it is transmitting. This causes the FDY's process variable and output to match its input.

Most transmitters can only trim at the 0% and 100% points of the scale, but the FDY can trim any point along the scale. Note that one-point trimming applies an offset to the sensor reading, while two-point trimming applies both an offset and gain.

Before you attempt to trim the FDY, ensure that the correct sensor is attached to the transmitter, then go to the *Trimming* tab as shown at the left, and:

1. Select the *User* radio button under *Trim Mode*, then answer *Yes* to the "Please confirm that you want to do this" prompt.
2. Select one or two trim points by clicking the appropriate button under *Trim Points*.
3. Enter the value you want to trim into the *Set Value* box under *Point 1* and click *Set*. Apply the value you entered in the *Set Value* section to the FDY. Click on the *Trim Pt 1* button. This matches the signal from the sensor to the first point you selected.
4. If you selected two trim points, enter the second value that you want to trim into the *Set Value* box under *Point 2* and click *Set*. Then apply the value you entered in the *Point 2* box to the FDY. Click on the *Trim Pt 2* button. This matches the signal from the sensor to the second point you selected.
5. You have now finished trimming your sensor and can continue on to *Output Trimming*.

Output Trimming

Output Trimming increases the accuracy of your transmitter by matching the reading of its recorded output to its actual output. Essentially, this means that it will eliminate any error in the unit that is reading the FDY's output.

To start trimming the output, hook-up the transmitter in the loop shown in Figure 6, and connect either a multimeter (preferably), or the unit that will be reading the FDY's signal to the transmitter's output.

1. Click the *Fix Current Low* button. This should cause the FDY to output 4mA. If it is outputting a different value, enter the value that the FDY is outputting (in mA) into the *Output Current* box, then click *Trim Low*.
2. Check what your multimeter displays as the transmitters output. If it is still not precisely 4mA, enter it into the *Output Current* box again and click *Trim Low* again. Repeat until your multimeter displays an acceptable reading.
3. When you are finished, click *Un-Fix Current*. After doing this, the output will still be trimmed, but the output will no longer be fixed at 4mA.
4. Continue by clicking the *Fix Current High* button. This should cause the FDY to output 20mA. If the

output is a different value, enter it into the *Output Current* box, then click *Trim High*.

5. Check what your multimeter displays as the transmitters output. If it is still not precisely 20mA, enter it into the *Output Current* again and click *Trim High* again. Repeat until your multimeter displays an acceptable reading.

6. When you are finished, click *Un-Fix Current*. After doing this, the output will still be trimmed, but the output will no longer be fixed at 20mA.

NOTE:

Clicking the *RESET* button will completely undo output trimming.

Loop Test

Use the *Loop Test* to trim other instruments in the loop.

1. To begin the loop test, enter the mA value you want the FDY to output to the Loop into the *Loop Test* text box. Click *Fix*.

2. Monitor the effect of this on the other instruments in the loop, and adjust accordingly.

3. If necessary, repeat steps 1 and 2 and enter a different value in the *Output Current* box.

4. When you are finished, click *Unfix*.

After the trimming parameters have been selected, you can continue on by either downloading the configuration or clicking the *Custom Curve* tab, and proceeding to the *Programming the Custom Curve Parameters* section.

Programming the Custom Curve Parameters

The *Custom Curve* section of the configuration software allows you to setup your own custom curve table with up to 128 points. In effect, this allows you to tell the transmitter what it should output when it receives a certain input. Use the *Custom Curve* tab for customizing the display's engineering units, reversing the output, signal limiting and creating custom curves.

Figure 11. *Custom Curve Parameters Tab*

The screenshot shows the 'Custom Curve' tab selected. The 'Custom Curve' section has an 'Enabled' checkbox checked and a 'Set' button. Below this is the 'Custom Curve (Y Value) Range & Units' section with input fields for 'Lower Range' (0), 'Upper Range' (100), and 'Display EGU label'. At the bottom are 'Read' and 'Set' buttons, and an 'Edit Table' button.

Follow these directions to setup your custom curve table:

1. Check the *Enabled* box in the *Custom Curve* section. Click the *Set* button and wait for the transmitter to finish downloading the information.

2. Input the *Lower Range* and the *Upper Range* into the appropriate boxes. The point you enter in the *Lower Range* will become the zero point of the transmitter, and the transmitter will send out a 4mA signal (or the selected output signal, if the zero output is set at a value other than 4mA) when this

point is reached. Likewise, the point you enter into the *Upper Range* will cause the transmitter to output 20mA (or full output signal, if different) when that point is reached.

3. Enter the desired engineering unit into the *Display EGU label* box. This will control what type of engineering unit (up to 5 alphanumeric characters, excluding symbols) is displayed by the Configuration Software and on the FDY's display.

4. Click *Set* to download all of the information to the transmitter.

NOTE:

"Read" will upload the information from the transmitter

to the configuration program. This can be used to take the last table that you have downloaded to the transmitter and enter it into the PC Configuration Software.

5. Click *Edit Table* to begin creating your own custom curve table (see next page for instructions).

IMPORTANT:

Once you enable the custom curve, you must edit the table in order for your transmitter to work properly.

Editing the Custom Curve Table

To edit custom table points, click *Edit Table* in the *Custom Curve* tab, then follow the directions below.

1. If you have already written a custom table in Microsoft® Excel (and saved it in a .csv format) or in our PC Configuration Software, you can open it from the *Edit Table* menu. Go to *File* (at the top, left corner of the screen, on the command bar), and click *Open*, then select the appropriate file.

2. If you have NOT already written a custom table, begin writing one by clicking the *Edit Table* button and selecting the number of points you would like to define. Do this in the *Number of Points* section.


3. Make sure that the *Custom Curve Enabled* box is checked. If not, check it and click the *Set* button.

4. Fill in the values in the *X* and *Y* columns. *X* is the input column—it represents the value that is input into the FDY. *Y* is the output column—it represents the value (in engineering units) that the transmitter

will output when the value in the *X* column is input. It is also the value that will be displayed in the PC Software and on the FDY display. If an input falls in between two *X* values, then the output will be scaled to match the percentage difference between the two *X* points.

5. When you have filled in all of the custom curve points, click *Download*. This will download the information from the PC Configuration Software to the transmitter. If you later want to retrieve the file from the transmitter to the PC Configuration Software, you can reattach the transmitter and click *Upload*. You are now done configuring your custom table, and if you have made changes to other parts of the configuration program, you are ready to download the configuration file.

Downloading the Configuration File

After the configuration has been set to your satisfaction, it can be downloaded to the unit by selecting *Download* from the *Transfer Menu* or by pressing the *Download* button () on the status bar. Downloading the configuration displayed in the PC program overwrites the unit's current configuration.

Downloading the configuration to the FDY may take up to 30 seconds to complete. It is important to let the sequence finish before taking any other action.

Once completed, the *Device Configuration* portion of the screen (in the bottom-left corner) will change to match the configuration listed on the rest of the screen. The status indicator in the top left hand corner of the view will then indicate the program has reverted back to its idle mode.

Installing the FDY

Moore Industries suggests installing the FDY by first mounting the unit in its intended application, then making the electrical connections to input, output and power.

Mounting

The FDY is built in a HP housing and can be shipped with one of our durable field-mount enclosures, such as the BH or D-BOX. Use the BH for tough, explosion-proof protection, or the D-BOX for areas where you need durable, reliable protection for your display.

The FDY is also versatile enough to be mounted on a surface, relay track, pipe or inside one of our field enclosures.

Electrical Connections

The connections for the various single FDY inputs are shown in the following diagram.

CE Conformity

Installation of any Moore Industries' products that bears the CE mark **must** adhere to the guidelines in **Installing the FDY** in order to meet the requirements set forth in the applicable European Union EMC (Electromagnetic Compatibility) Directive.

Recommended Ground Wiring Practices


Moore Industries recommends the following ground wiring practices:

- Any Moore Industries product in a metal case or housing should be grounded.
- The protective earth conductor must be connected to a system safety earth ground before making any other connections.
- All input signals to, and output signals from, Moore Industries' products should be wired using a shielded, twisted pair wiring technique. Shields should be connected to an earth or safety ground.
- For the best shielding, the shield should be run all the way from the signal source to the receiving device. (see Note below)
- The maximum length of unshielded input and output signal wiring should be 2 inches.

NOTE:

Some of Moore Industries' instruments can be classified as receivers (IPT2, IPX2, etc.) and some can be classified as transmitters (TRX, TRY, etc.) while some are both a receiver and a transmitter (SPA2, HIM, etc). Hence, your shield ground connections should be appropriate for the type of signal line being shielded. The shield should be grounded at the receiver and not at the signal source.

Figure 12. Hook-Up Diagram for Installing the FDY into the Application

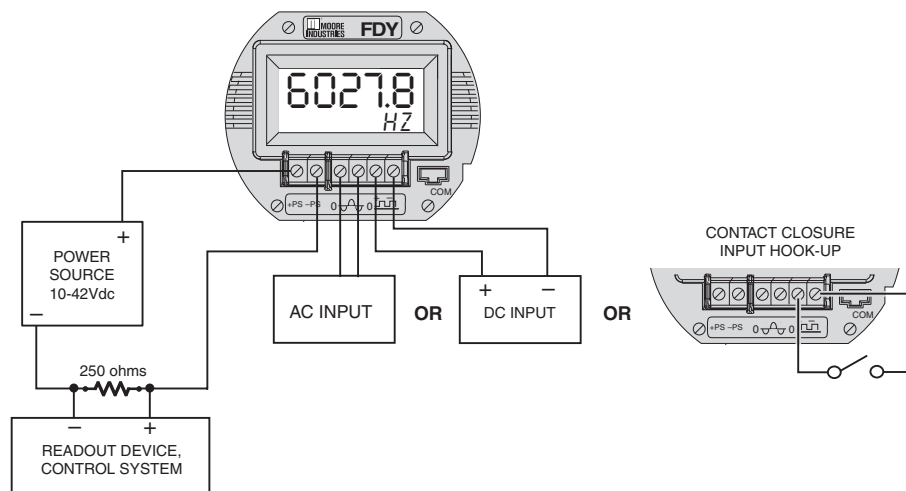

Installation in Hazardous Locations

This section contains important information regarding installation of the FDY in Hazardous Area Locations.

Warning

Substitution of components is not allowed, as it may impair the intrinsic safety.

Avertissement:

La substitution de composants peut compromettre la sécurité intrinsèque

Warning

To prevent ignition of flammable or combustible atmospheres, disconnect power before servicing.

Avertissement:

Risque d'explosion. Avant de déconnecter l'équipement, couper le courant ou s'assurer que débrancher tant que l'emplacement est désigné non dangereux.

Warning

Explosion hazard. Do not disconnect equipment when a flammable or combustible atmosphere is present.

Avertissement

Risque d'explosion. Ne pas débrancher tant que le circuit est sous tension, à moins qu'il ne s'agisse d'un emplacement non dangereux.

Specific Conditions of Use

The following instructions must be adhered to when the FDY is used in Hazardous Area Locations or Potentially Explosive Atmospheres.

FM Installations

Intrinsically Safe Applications

Class I, II, III Division 1, Groups A-G, T4 Ta = 60°C
Class I, Zone 0, AEx ia IIC T4 Ta = 60°C

Nonincendive Applications

Class I, Division 2, Groups A-D, T4 Ta = 60°C

The Model FDY shall be installed in compliance with the enclosure, mounting, spacing and segregation requirements of the ultimate application.

No connections shall be made to the communications "COM" port in Hazardous (Classified) Locations.

Maximum operating parameters of the "COM" port for use in Non-Hazardous areas shall not exceed 3.0V, 300mA and 240mW.

CSA Installations

Class I, II, III, Division 1, Groups A-G, T4 Ta = 60°C
Installation of the Model FDY into Class I Division 1 locations requires the use of CSA Certified Intrinsic Safety Barrier with the following Entity Parameters.

Vmax or Ui = 30Vdc;
Voc or Uo = 5.355Vdc;
Ci or Co = 18nF;
Imax or Ii = 110mA;
Isc or It = 5.15mA;
Li or Lo = 0uH;
Pmax or Pi = 825mW;
Pt or Po = 6.9mW;
Ca = 65uF;
La = 850mH;

Class I, II, III, Division 2, Groups A-G, Ta = 60°C
The model FDY should be connected to a CSA certified Separated Extra Low Voltage (SELV) power source as per Annex H of C22.2 No. 1010.1-92.
Due to the presence of exposed wiring terminals the model FDY should be mounted in a Moore Industries BH or SB type enclosure or CSA certified equivalent.

European Union Installations

(ATEX 2014/34/EU Directive)

Intrinsically Safe Applications - Zone 0

II 1 G EEx ia IIC T4

The model FDY is intrinsically safe. It can be used in potentially explosive atmospheres and can only be connected to certified intrinsically safe associated equipment. This combination must be compatible with regards to intrinsic safety.

The specific electrical parameters of the FDY are:
Power Supply: Ui ≤ 30V; Ii ≤ 110mA; Pi ≤ 0.825W;
Ci ≤ 18nF; Li = 0
Output: Uo ≤ 6.51V; Io ≤ 16mA, Po ≤ 0.260W;
Co ≤ 22uF; Lo ≤ 146mH

Installation in non-Hazardous Locations

This section contains important information regarding installation of the FDY in non Hazardous Area Locations.

Specific Conditions of Use

The following instructions must be adhered to when the FDY is used in non Hazardous Area Locations.

CSA Installations

Ordinary Locations


The model FDY should be connected to a CSA certified Separated Extra Low Voltage (SELV) power source as per Annex H of C22.2 No. 1010.1-92.

The model FDY is for indoor use only unless mounted in a Moore Industries type "D-Box" or equivalent CSA certified enclosure.

Customer Service

If service assistance is ever required for one of the FDYs in your application, refer to the back cover of this manual for the telephone numbers to Moore Industries STAR Center customer service department.

If possible, make a note of the model number of the offending unit before calling. For fastest assistance, try to gather information on the unit(s) serial number and the job and purchase order number under which it was shipped.

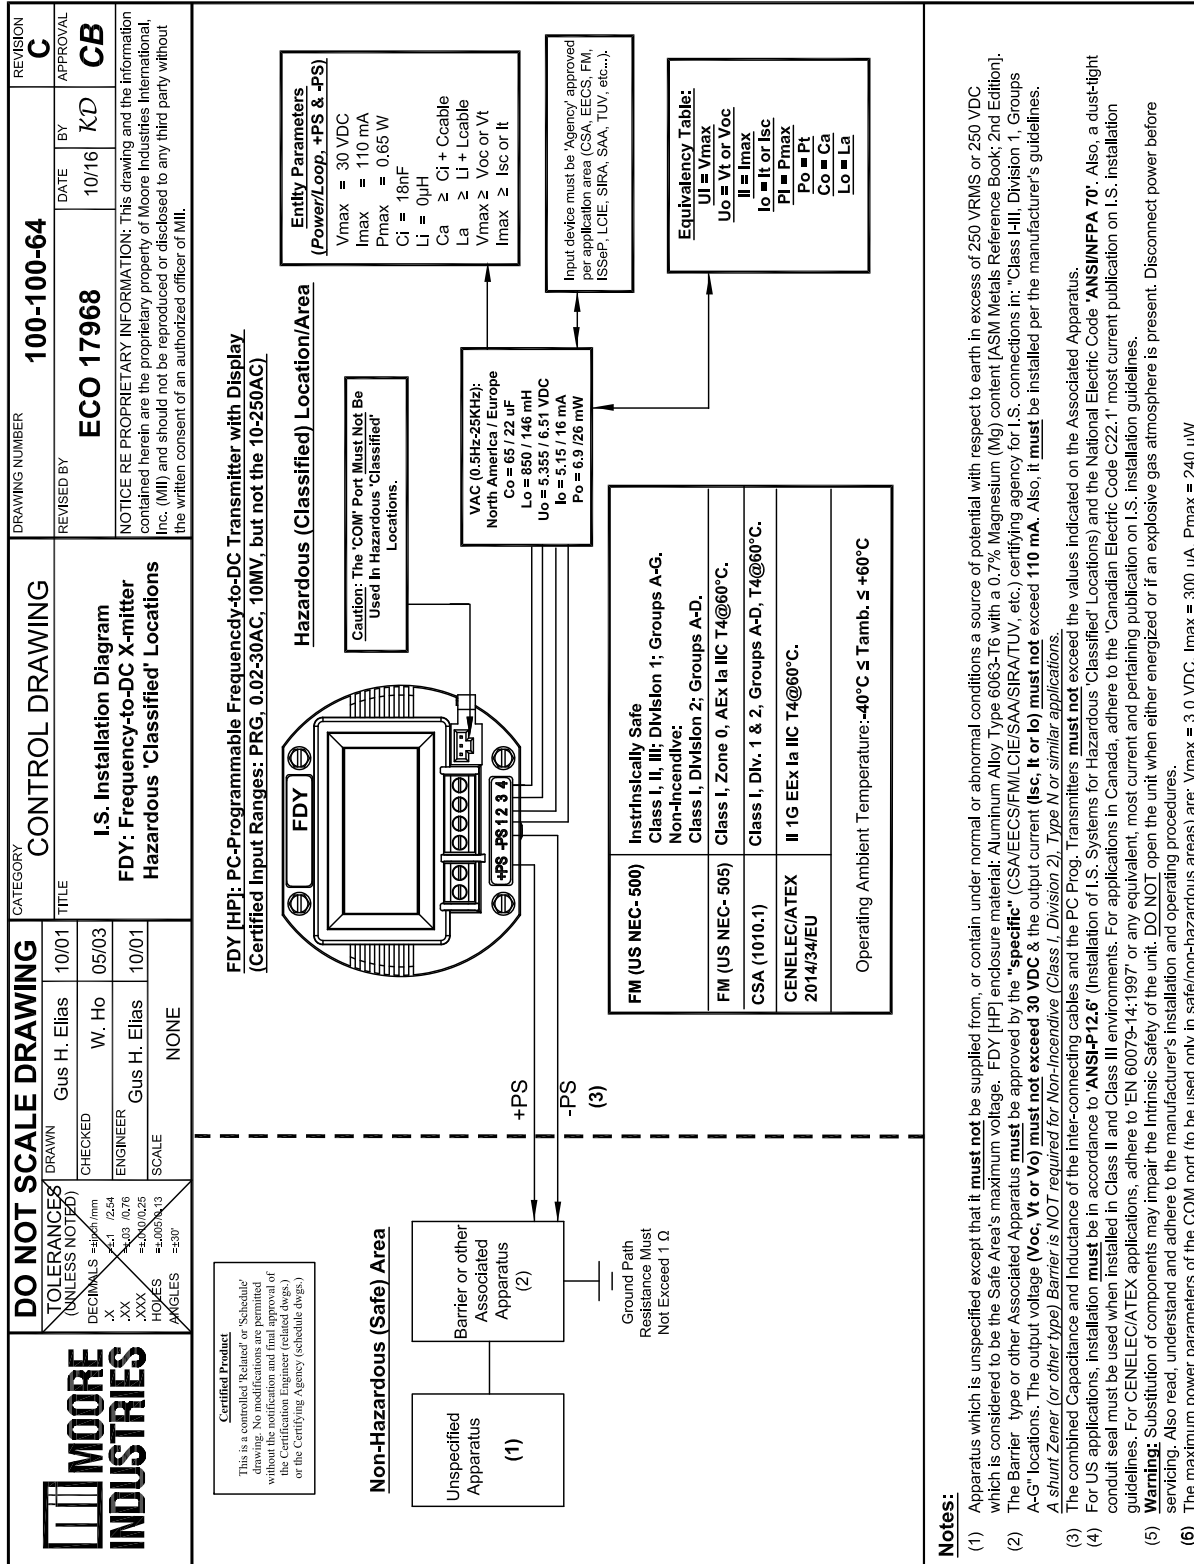

Notes:

- Apparatus which is unspecified except that it **must not** be supplied from, or contain under normal or abnormal conditions a source of potential with respect to earth in excess of 250 VRMS or 250 VDC which is considered to be the Safe Area's maximum voltage. FDY [HP] enclosure material: Aluminum Alloy Type 6063-T6 with a 0.7% Magnesium (Mg) content (ASM Metals Reference Book; 2nd Edition).
- The Barrier type or other Associated Apparatus **must** be approved by the "specific" (CSA/EECS/FM/LCIE/SAA/SIRA/TUV, etc.) certifying agency for I.S. connections in: "Class I-III, Division 1, Groups A-G" locations. The output voltage (V_{oc} , V_t or V_o) **must not exceed 30 VDC** & the output current (I_{sc} , I_t or I_o) **must not exceed 110 mA**. Also, it **must** be installed per the manufacturer's guidelines. A *shunt Zener (or other type) Barrier is NOT required for Non-Incendive (Class I, Division 2), Type N or similar applications.*
- The combined Capacitance and Inductance of the inter-connecting cables and the PC Prog. Transmitters **must not** exceed the values indicated on the Associated Apparatus.
- For US applications, installation **must** be in accordance to 'ANSI-P12.6' (Installation of I.S. Systems for Hazardous 'Classified' Locations) and the National Electric Code 'ANSI/NFPA 70'. Also, a dust-tight conduit seal must be used when installed in Class II and Class III environments. For applications in Canada, adhere to the 'Canadian Electric Code C22.1' most current publication on I.S. installation guidelines. For CENELEC/ATEX applications, adhere to 'EN 60079-14:1997' or any equivalent, most current and pertaining publication on I.S. installation guidelines.
- Warning:** Substitution of components may impair the Intrinsic Safety of the unit. DO NOT open the unit when either energized or if an explosive gas atmosphere is present. Disconnect power before servicing. Also read, understand and adhere to the manufacturer's installation and operating procedures.
- The maximum power parameters of the COM port (to be used only in safe/non-hazardous areas) are: $V_{max} = 3.0 \text{ VDC}$, $I_{max} = 300 \mu\text{A}$, $P_{max} = 240 \mu\text{W}$.

RETURN PROCEDURES

To return equipment to Moore Industries for repair, follow these four steps:

1. Call Moore Industries and request a Returned Material Authorization (RMA) number.

Warranty Repair –

If you are unsure if your unit is still under warranty, we can use the unit's serial number to verify the warranty status for you over the phone. Be sure to include the RMA number on all documentation.

Non-Warranty Repair –

If your unit is out of warranty, be prepared to give us a Purchase Order number when you call. In most cases, we will be able to quote you the repair costs at that time. The repair price you are quoted will be a "Not To Exceed" price, which means that the actual repair costs may be less than the quote. Be sure to include the RMA number on all documentation.

2. Provide us with the following documentation:
 - a) A note listing the symptoms that indicate the unit needs repair
 - b) Complete shipping information for return of the equipment after repair
 - c) The name and phone number of the person to contact if questions arise at the factory
3. Use sufficient packing material and carefully pack the equipment in a sturdy shipping container.
4. Ship the equipment to the Moore Industries location nearest you.

The returned equipment will be inspected and tested at the factory. A Moore Industries representative will contact the person designated on your documentation if more information is needed. The repaired equipment, or its replacement, will be returned to you in accordance with the shipping instructions furnished in your documentation.

WARRANTY DISCLAIMER

THE COMPANY MAKES NO EXPRESS, IMPLIED OR STATUTORY WARRANTIES (INCLUDING ANY WARRANTY OF MERCHANTABILITY OR OF FITNESS FOR A PARTICULAR PURPOSE) WITH RESPECT TO ANY GOODS OR SERVICES SOLD BY THE COMPANY. THE COMPANY DISCLAIMS ALL WARRANTIES ARISING FROM ANY COURSE OF DEALING OR TRADE USAGE, AND ANY BUYER OF GOODS OR SERVICES FROM THE COMPANY ACKNOWLEDGES THAT THERE ARE NO WARRANTIES IMPLIED BY CUSTOM OR USAGE IN THE TRADE OF THE BUYER AND OF THE COMPANY, AND THAT ANY PRIOR DEALINGS OF THE BUYER WITH THE COMPANY DO NOT IMPLY THAT THE COMPANY WARRANTS THE GOODS OR SERVICES IN ANY WAY.

ANY BUYER OF GOODS OR SERVICES FROM THE COMPANY AGREES WITH THE COMPANY THAT THE SOLE AND EXCLUSIVE REMEDIES FOR BREACH OF ANY WARRANTY CONCERNING THE GOODS OR SERVICES SHALL BE FOR THE COMPANY, AT ITS OPTION, TO REPAIR OR REPLACE THE GOODS OR SERVICES OR REFUND THE PURCHASE PRICE. THE COMPANY SHALL IN NO EVENT BE LIABLE FOR ANY CONSEQUENTIAL OR INCIDENTAL DAMAGES EVEN IF THE COMPANY FAILS IN ANY ATTEMPT TO REMEDY DEFECTS IN THE GOODS OR SERVICES, BUT IN SUCH CASE THE BUYER SHALL BE ENTITLED TO NO MORE THAN A REFUND OF ALL MONIES PAID TO THE COMPANY BY THE BUYER FOR PURCHASE OF THE GOODS OR SERVICES.

ANY CAUSE OF ACTION FOR BREACH OF ANY WARRANTY BY THE COMPANY SHALL BE BARRED UNLESS THE COMPANY RECEIVES FROM THE BUYER A WRITTEN NOTICE OF THE ALLEGED DEFECT OR BREACH WITHIN TEN DAYS FROM THE EARLIEST DATE ON WHICH THE BUYER COULD REASONABLY HAVE DISCOVERED THE ALLEGED DEFECT OR BREACH, AND NO ACTION FOR THE BREACH OF ANY WARRANTY SHALL BE COMMENCED BY THE BUYER ANY LATER THAN TWELVE MONTHS FROM THE EARLIEST DATE ON WHICH THE BUYER COULD REASONABLY HAVE DISCOVERED THE ALLEGED DEFECT OR BREACH.

RETURN POLICY

For a period of thirty-six (36) months from the date of shipment, and under normal conditions of use and service, Moore Industries ("The Company") will at its option replace, repair or refund the purchase price for any of its manufactured products found, upon return to the Company (transportation charges prepaid and otherwise in accordance with the return procedures established by The Company), to be defective in material or workmanship. This policy extends to the original Buyer only and not to Buyer's customers or the users of Buyer's products, unless Buyer is an engineering contractor in which case the policy shall extend to Buyer's immediate customer only. This policy shall not apply if the product has been subject to alteration, misuse, accident, neglect or improper application, installation, or operation. THE COMPANY SHALL IN NO EVENT BE LIABLE FOR ANY INCIDENTAL OR CONSEQUENTIAL DAMAGES.



WORLDWIDE • www.miinet.com

United States • info@miinet.com
Tel: (818) 894-7111 • FAX: (818) 891-2816
Australia • sales@mooreind.com.au
Tel: (02) 8536-7200 • FAX: (02) 9525-7296

Belgium • info@mooreind.be
Tel: 03/448.10.18 • FAX: 03/440.17.97
The Netherlands • sales@mooreind.nl
Tel: (0)344-617971 • FAX: (0)344-615920

China • sales@mooreind.sh.cn
Tel: 86-21-62491499 • FAX: 86-21-62490635
United Kingdom • sales@mooreind.com
Tel: 01293 514488 • FAX: 01293 536852